



ENGINEERING CHANGE NOTE:

ECN #: 1057

ASSEMBLY: BCCP101B-D

NEW ASSEMBLY: BCCP101B-D1

CURRENT REV: D

NEW REV: D1

DESCRIPTION: CCP - Crystal Core Processor Card

DATE: 02/09/2009

Apply to all WIP. Apply to all existing Stock. Not required for BCCP101C-E .

REASON FOR CHANGE:

- | | | | |
|--|--|---------------------------------------|--------------------------------------|
| <input type="radio"/> Safety Issue | <input type="radio"/> UL Compliance Issue | <input type="radio"/> New Feature | <input type="radio"/> Cost Reduction |
| <input checked="" type="radio"/> Bug Fix | <input type="radio"/> EMC Compliance Issue | <input type="radio"/> Quality Issue | |
| <input checked="" type="radio"/> Reliability Reasons | <input type="radio"/> Software Change | <input type="radio"/> Cosmetic Change | |

LED scan too fast or not running at all after power on, due to PCI clock stopped or running at 100MHz instead of 66MHz

COMPATIBILITY MAINTAINED: Yes

DETAILS OF CHANGE:

Add SDK1672 Diode BAT54A to back of PCB:
Anode to LPCI_PERRn, cathode to PERST_IN#

See page2 for details.

Secure with hot glue

Label Rev D1

.

SIGNATURES:

Engineer:

Implementor:

Date:

Operations Manager:

