ECN#

390

Page 1 of 1

## Juilight engineering change note:

mfx3

**ASSEMBLY:** APS1611 **DESCRIPTION:** MW4-PS1 Power Supply Assembly New Assembly: **DATE:** 16/10/00 **Current Assy Rev: Current Schematic Rev: New Assy Rev: New Schematic Rev:** Applies to all PS1 assembly revisions. CMS BOMs Updated Excel BOMs Updated O Subcontractor Records Updated Compatibility Maintained: Yes IMPLEMENTATION INFORMATION: Safety Issue O Cost Reduction UL Compliance Issue O New Feature **Bug Fix EMC Compliance Issue** Quality Issue **Reliability Reasons** ○ Software Change Cosmetic Change **REASON FOR CHANGE:** Rectify unsafe assembly. **DETAILS OF CHANGE:** 1. The IEC Mains Power Inlet (JMM2453) may fall out of it's normal mounting position.

- 2. Fit a cable tie,  $200 \times 4.5 \text{mm}$  (FMT8965) under the mounting tabs of the IEC connector. The cable tie is to be on the inside of the metal panel. Aim to spread the locking tabs so they make sufficient purchase on the metalwork.
- 3. Refer to the attached picture for more detail.